


MKX²1083 LIFT-ASSIST INTERFERENCE – FIELD FIX BULLETIN

ECN ID #	4401
DATE	July 13, 2023
BRAND	Westfield
MODEL	MKX ² 1083
DETAILS	MKX ² 1083 lift-assist interferes with the lower truss bracket.

Problem

Many MKX2013 augers were shipped with the incorrect stroke limiter plate causing the lift-assist to interfere with the lower truss bracket when fully raised.

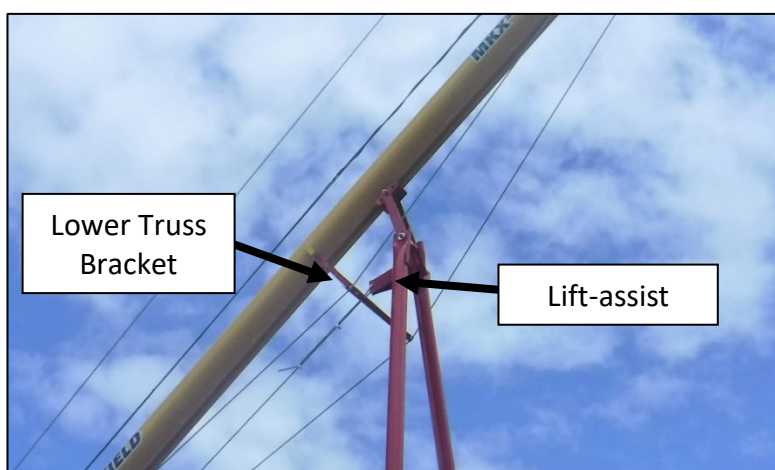

Solution:

At the lift cylinder (part # 202679RD), replace the current stroke limiter plate (part # 202900RD) with the correct version (part # 202901RD). This will reduce the stroke and prevent the auger from lifting too high as to hit the lower truss bracket. **NOTE:** The lift cable length will need to be re-adjusted given the new resting state of the cylinder.

