

13" TRACK STOP INTERFERENCE – FIELD BULLETIN

ECN ID #	ECN 4679
DATE	April 29, 2025
BRAND	AGI, Westfield, Hutchinson, Mayrath
MODEL	MKX21384/94/114, HX213114, X213114
DATE RANGE	February 2025 – April 2025
DETAILS	Some 13" auger tracks have been found to have the track stop holes punched off-centre, causing the track stop to contact the lift assist during operation.

We have observed that on some 13" tubes, the holes for the track stop are punched off-centre. The affected tube bundles are 202623BK/SR/YL and 202622BK/SR/YL. Figure 1 illustrates the off-centre holes.

Check any tube bundles within the specified date range and measure the offset distance of the track holes. To do this, measure from the edge of the track to the edge of the hole. A deviation less than 1/16" is acceptable and requires no further action. A deviation between 1/16" up to 3/16" requires a new, updated version of the track stop, as shown in figure 2. If the deviation exceeds 3/16", contact customer service, as additional action may be required.

The part number for the track stop is 10-20296 – MKX130-84/94/114 TRACK STOP. Use existing hardware to mount track stop. Make sure the track stop is properly centered after mounting.



Figure 1 Off centered punched holes on track stop

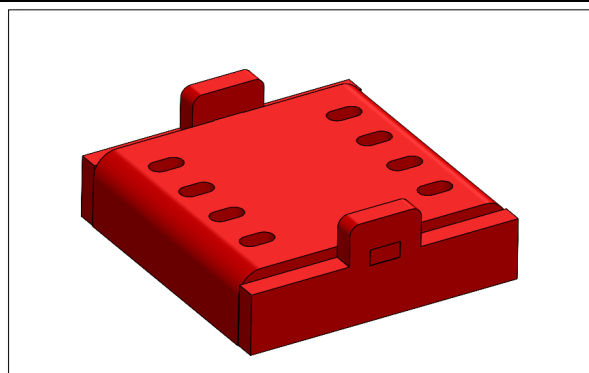


Figure 2 Updated track stop